


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49101	Main Street: PROSPERITY_CROSSING_DR	Cross Street: DOCIA_CROSSING_RD	Location: SW
ADA ID: 1AF9B8045EFF	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

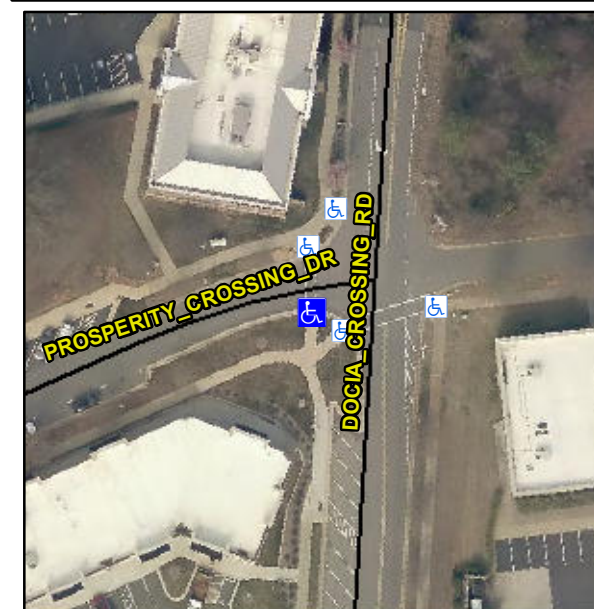

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.2, R304.5.3

Total Cost: \$ 1550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	174.0	Yes	Ramp Slope (%)	6.7
Yes	Ramp Width (in)	72.0	Yes	Ramp XSlope (%)	1.6
Yes	Flare Type LT	Curbed_NoWalkSurface	Yes	Flare Type RT	N/A
Yes	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	75.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	73.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.8
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	59.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.2		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name PROSPERITY CROSSING DR

Stop Condition-Street 2 StopSign

Street 2 Name N/A

Stop Condition-Street 1 N/A

