


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 45502	Main Street: CAPTAIN ARDREY RD	Cross Street: TRIPLE OAK RD	Location:	W
ADA ID: 1B43351F09D2	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

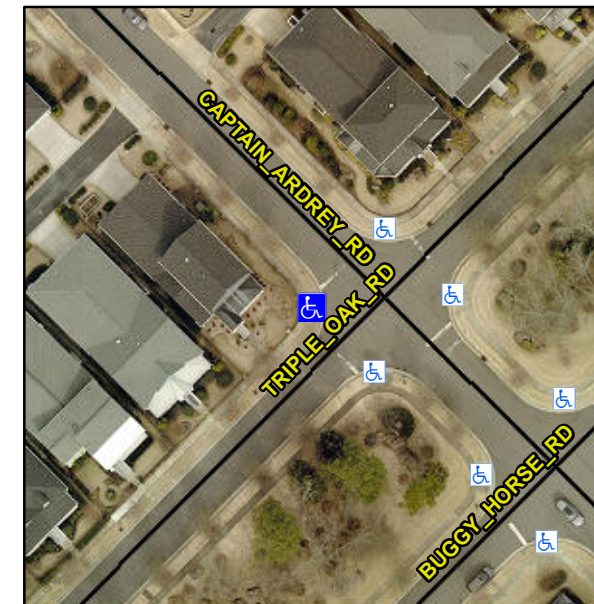

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**Not Found, R304.5.1, R304.2.2, R304.5.3**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	48.0	N/A	Ramp Length RT (in)	43.0
Yes	Ramp Width LT (in)	48.0	Yes	Ramp Width RT (in)	48.0
Yes	Ramp Slope LT (%)	5.7	Yes	Ramp Slope RT (%)	4.5
No	Ramp XSlope LT (%)	3.9	No	Ramp XSlope RT (%)	2.2
N/A	Ramp Length (in)	73.0	No	Ramp Slope (%)	9.5
No	Ramp Width (in)	35.0	No	Ramp XSlope (%)	3.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	2.0
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	3.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.2		Clear Space?	N/A
	Road X Slope (%)	1.7	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	18.1			

Street 1 Name StopSign  
 Stop Condition-Street 1 TRIPLE OAK RD  
 Street 2 Name StopSign  
 Stop Condition-Street 2 CAPTAIN ARDREY RD

