

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

8.6

7.3

Intersection ID: 23368 Main Street: S\_TRYON\_ST Cross Street: SOUTH\_POINT\_BV Location: SW

ADA ID: 1B8A5FCFB42F Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 61.25

Compliance Description

Ramp Length (in)

Ramp Width (in)

N/A

No

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

No

No

Compliance Description


Ramp Slope (%)

Ramp XSlope (%)

Data

59.0

47.0

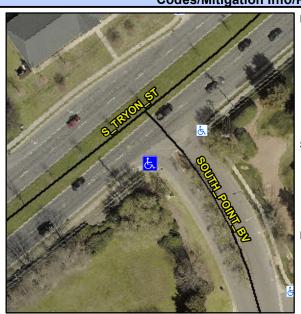

Street 1 Name
SOUTH POINT BV
Stop Condition-Street 2
StopSign
Street 2 Name
N/A
Stop Condition-Street 1
N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2, R304.5.3, R302.7



Total Cost:



1850.00



