

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 12056 Main Street: ELLIOTT\_ST Cross Street: W\_MOREHEAD\_ST Location: SW

ADA ID: 1BDE699FF635 Ramp Type: Directional2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

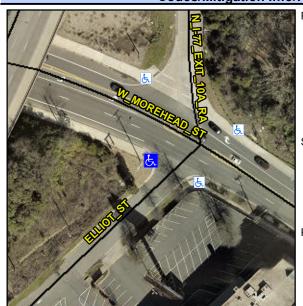

Street 1 Name ELLIOT ST
Stop Condition-Street 1 StopSign
Street 2 Name N/A
Stop Condition-Street 2 N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2

Total Cost: \$ 1800.00

Field Measurements/Component Compliance					
Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length (in)	64.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	108.0	N/A	Grade Break Slope (%)	0.0
No	Ramp Slope (%)	9.0	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	1.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	5.2
	X Walk 1 Direction	To SE		Road X Slope (%)	2.3
	X Walk 1 Width (in)	N/A		Clear Space?	N/A
	X Walk 1 Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.3	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
		N/A	N/A	Curb Slope (%)	2.1





