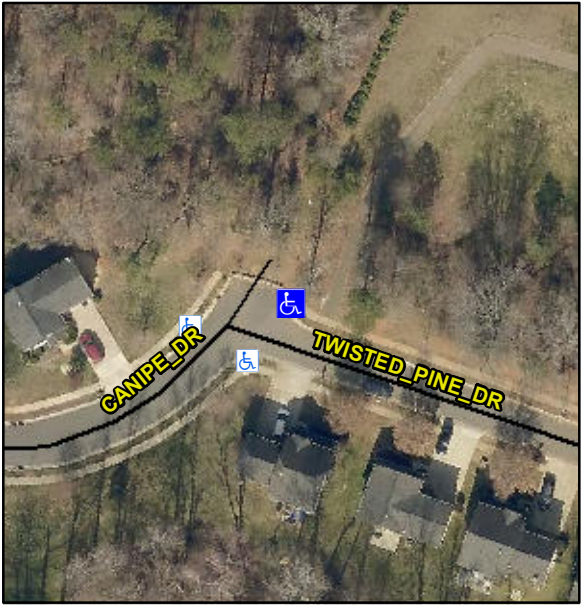


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47616	Main Street: TWISTED_PINE_DR	Cross Street: CANIPE_DR	Location: E
ADA ID: 1C085677EAE7	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:						
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	48.5	Yes	Ramp Slope (%)	5.3
		No	Ramp Width (in)	47.5	No	Ramp XSlope (%)	6.8
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	5.0		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3</p>							
			Road Slope (%)	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good

Street 1 Name	TWISTED PINE DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 1850.00

