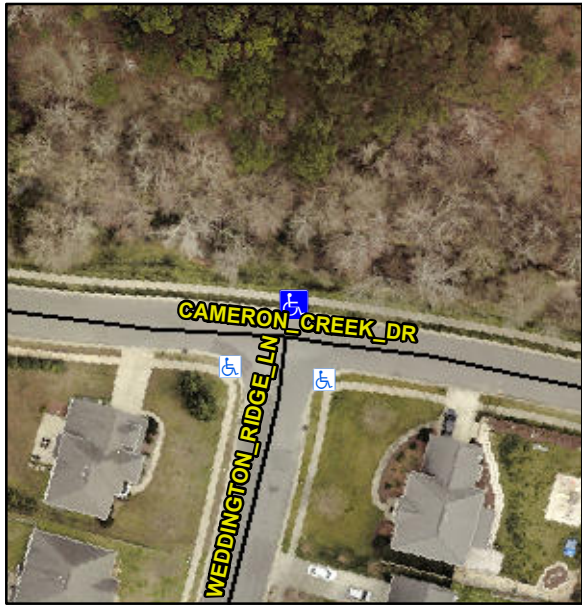


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29678	Main Street: CAMERON_CREEK_DR	Cross Street: WEDDINGTON_RIDGE_LN	Location:	N
ADA ID: 1CCA632CD921	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.6
	Remove & Replace Gutter.		Yes	Ramp Width (in)	51.0	Yes	Ramp XSlope (%)	0.3
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	4.1	Yes	Flare Slope RT (%)	1.9
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	48.0	No	DWS Provided?	No
			Yes	Landing Width (in)	51.0	N/A	DWS Contrast?	No
			No	Landing Slope (%)	5.4	N/A	DWS Length (in)	N/A
			No	Landing X Slope (%)	2.3	N/A	DWS Full Width?	No
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
PROW/ADA:		R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4	N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	No	Gutter Slope (%)	9.9
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.7
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To S		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.0		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	Clear Space?	Yes
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 2600.00						

