


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27490	Main Street: BALLANTYNE_COMMONS_PY	Cross Street: JOHNSTON_RD	Location: SE
ADA ID: 1D3F7C70432F	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

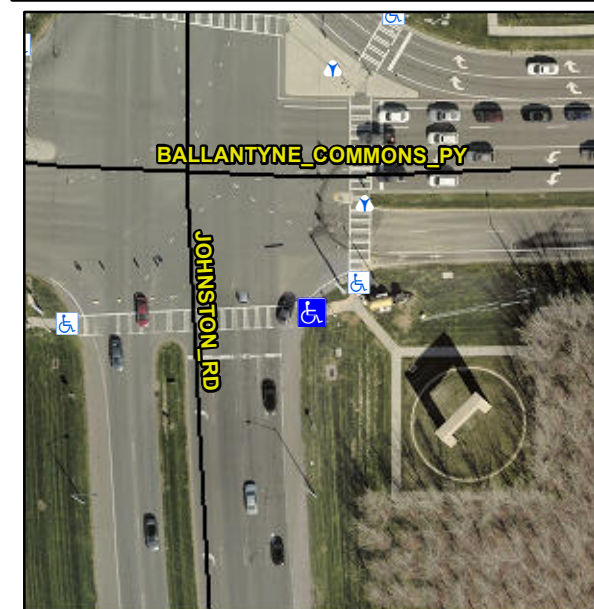

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

NO CURB LINE

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.2, R305.2, R304.5.3**

Street 1 Name	JOHNSTON RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	89.0	No	Grade Break?	No
Yes	Ramp Width (in)	72.0	N/A	Grade Break Slope (%)	5.1
Yes	Ramp Slope (%)	5.4	N/A	Grade Break XSlope (%)	1.1
Yes	Ramp XSlope (%)	1.0			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	49.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.9	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	6.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	51.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	5.8
N/A	Painted X Walk1?	Yes		Road Slope (%)	3.5
	X Walk 1 Direction	To SW		Road X Slope (%)	4.0
	X Walk 1 Width (in)	130.0		Clear Space?	Yes
	X Walk 1 Slope (%)	3.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.0	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

