

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 44911 Main Street: FOX POINT DR **Cross Street: SPRINGHAVEN DR** Location: W

ADA ID: 1D40273A1A79 Ramp Type: Perp Initial Pass/Fail: Pass **Overall Compliance: No Severity Score:** 7.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

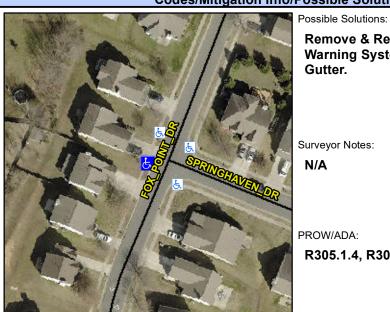

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4, R304.5.4

The same of the sa	MINISTER STATE OF THE STATE OF
Street 1 Name	FOX POINT DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: 1550.00

Comp	liance Description	Data	Comp	liance Description	Data
N/A	Ramp Length (in)	48.5	Yes	Ramp Slope (%)	6.7
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	0.7	N/A	Flare Slope RT (%)	5.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	52.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	2.5	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	14.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A

Surface Condition? (G/P)

Good





