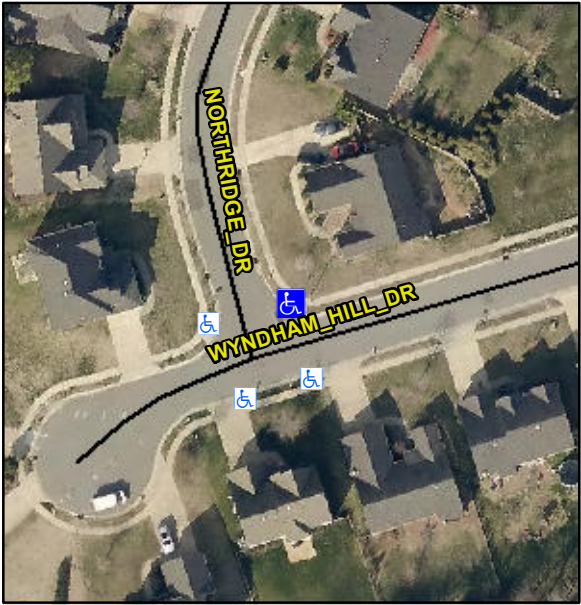


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29920	Main Street: NORTHRIDGE_DR	Cross Street: WYNDHAM_HILL_DR	Location: NE
ADA ID: 1D57407CA406	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.5.1, R304.2.2				
	Street 1 Name	NORTHRIDGE DR		Stop Condition-Street 2	StopSign
	Street 2 Name	WYNDHAM HILL DR		Stop Condition-Street 1	None
	Total Cost:	\$	3200.00		
		Compliance	Description	Data	Compliance
		N/A	Ramp Length (in)	52.0	No
		No	Ramp Width (in)	38.0	Yes
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To W	
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	0.3	
			X Walk 1 X Slope (%)	0.4	
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	0.8	N/A
			Road X Slope (%)	0.2	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P)
					Good

