


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30292	Main Street: DERRYFIELD_DR	Cross Street: NIGEL_CT	Location: S
ADA ID: 1D74BB2755BF	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 10
			Field Measurements/Component Compliance

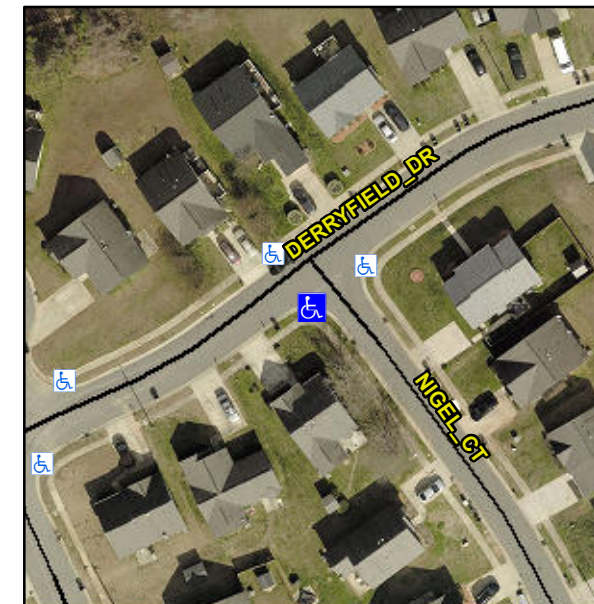

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

CURB WIDTH 44.5

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	42.0	Yes	BlendTrans Slope (%)	4.0
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	2.0
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	52.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.6	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	1.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.6
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	0.6
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	0.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.8		Clear Space?	Yes
	Road X Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	9.5

