

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 14442 Main Street: N_SHARON_AMITY_RD Cross Street: CENTRAL_AV Location: SW **ADA ID: 1D9A8C8D032E** Ramp Type: BlendTrans1 Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 8.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance



CENTRAL AV Street 1 Name Stop Condition-Street 1 Signal Street 2 Name N/A Stop Condition-Street 2 N/A **Remove & Replace Curb Ramp With** Two New Directional Ramps or Equivalent.

Surveyor Notes:


N/A

PROW/ADA:

Not Found, R304.5.1



Total Cost:

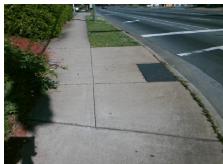

3200.00

Field Measurements/Component Compliance					
Comp	liance Description	Data	Comp	liance Description	Data
N/A	Ramp Length (in)	69.0	Yes	BlendTrans Slope (%)	2.4
No	Ramp Width (in)	42.5	Yes	BlendTrans XSlope (%)	1.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	105.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.0		Clear Space?	N/A
	Road X Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
	1 mm 1 m		No	Curb Slope (%)	30.9