


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 31180	Main Street: SPRING_PARK_DR	Cross Street: BARBEE_DR	Location: SW
ADA ID: 1E8C7B128AB5	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
 <div>Street 1 Name<div>BARBEE DR</div></div> <div>Stop Condition-Street 1<div>StopSign</div></div> <div>Street 2 Name<div>SPRING PARK DR</div></div> <div>Stop Condition-Street 2<div>None</div></div>	<div>Possible Solutions:</div> <div>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</div>			Compliance	Description	Data	Compliance	Description	Data
	N/A	Ramp Length (in)	49.0	Yes	BlendTrans Slope (%)	1.0			
	No	Ramp Width (in)	37.0	No	BlendTrans XSlope (%)	2.5			
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A			
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A			
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A			
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A			
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A			
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A			
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A			
<div>Surveyor Notes:</div> <div>N/A</div> <div>PROW/ADA:</div> <div>R304.5.1, R304.5.3</div>	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A			
	N/A	Shared Landing?	N/A						
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A			
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A			
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No			
		X Walk 1 Direction	To E		X Walk 2 Direction	To N			
		X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A			
		X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	1.0			
		X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	1.5			
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A			
<div>Total Cost:</div> <div>\$3200.00</div>		Road Slope (%)	0.9		Clear Space?	N/A			
		Road X Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A			
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A			
		Obstruction Type			Storm Grate/Utility Type				
					N/A			N/A	
					Yes	Surface Condition? (G/P)	Good		
					N/A	Curb Slope (%)	3.4		

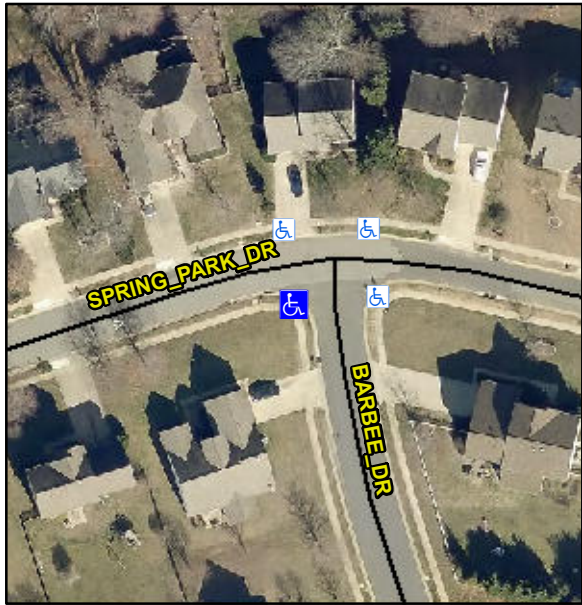