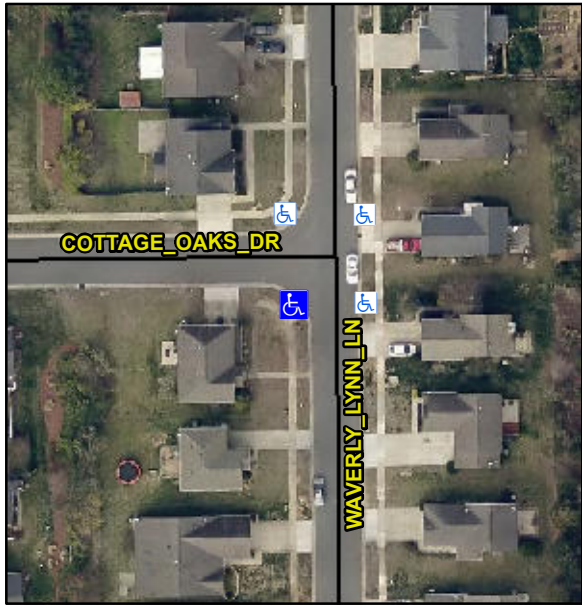


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2953	Main Street: COTTAGE_OAKS_DR	Cross Street: WAVERLY_LYNN_LN	Location: SW
ADA ID: 1E911F608755	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance											
 Street 1 Name Stop Condition-Street 1 Street 2 Name Stop Condition-Street 2 WAVERLY LYNN LN None COTTAGE OAKS DR StopSign			Possible Solutions:			Compliance			Description			Data		
			Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.			N/A			Ramp Length (in)			84.0		
						Yes			Ramp Width (in)			136.0		
						N/A			Flare Type LT			Sloped		
						N/A			Flare Slope LT (%)			3.1		
						N/A			Flare Traversable LT?			No		
						Yes			Landing Length (in)			48.0		
						Yes			Landing Width (in)			115.0		
						Yes			Landing Slope (%)			1.7		
						No			Landing X Slope (%)			2.9		
Surveyor Notes: VEGETATION OVERGROWTH PROW/ADA: R304.5.3, R305.1.4, R305.2, R304.5.4						N/A			Landing Curb? (Y/N)			No		
						N/A			Shared Landing?			No		
						Yes			Gutter Ponding?			No		
						Yes			Gutter Lip Ht (in)			0.0		
						N/A			Painted X Walk1?			No		
									X Walk 1 Direction			To E		
									X Walk 1 Width (in)			N/A		
									X Walk 1 Slope (%)			1.8		
									X Walk 1 X Slope (%)			0.1		
						N/A			Ramp inside XWalk1?			N/A		
Total Cost: \$ 3950.00									Road Slope (%)			2.6		
									Road X Slope (%)			1.3		
						Yes			Any Obstructions?			No		
									Obstruction Type					
												N/A		
												Yes		
												N/A		

