

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 24414	Main Street: MICHAEL_SHANE_CT	Cross Street: WRIGHT'S_FERRY_RD	Location: SW
ADA ID: 1E9B91B21E4C	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

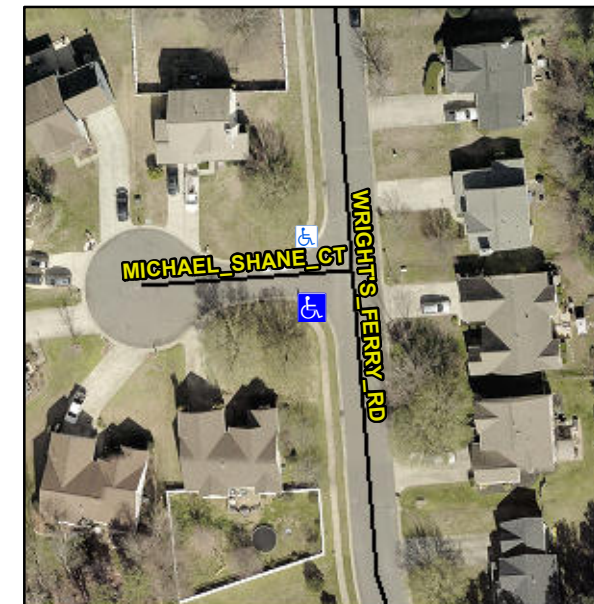

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	94.3	Yes	BlendTrans Slope (%)	2.3
Yes	Ramp Width (in)	83.5	Yes	BlendTrans XSlope (%)	0.7
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	No	DWS Provided?	No
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	0.5
	X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	0.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.7		Clear Space?	Yes
	Road X Slope (%)	6.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	13.6

Street 1 Name **WRIGHTS FERRY RD**

Stop Condition-Street 1 **None**

Street 2 Name **MICHAEL SHANE CT**

Stop Condition-Street 2 **StopSign**

