


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11980	Main Street: ALLEN_ST	Cross Street: E_17TH_ST	Location: W
ADA ID: 1EC788B62521	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 10			

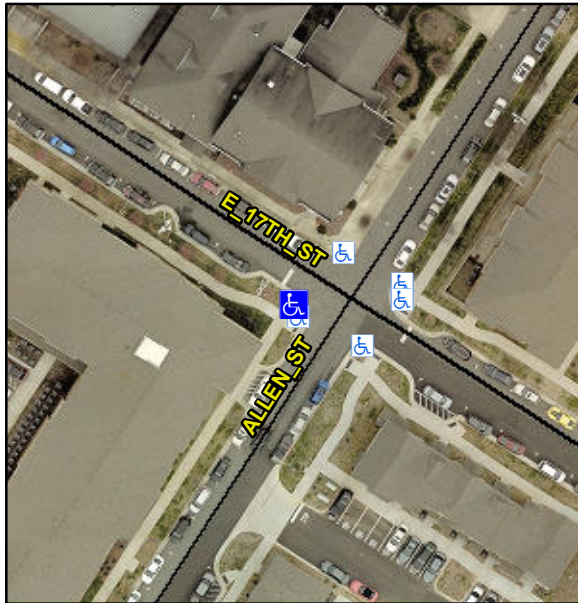

Possible Solutions:

Remove & Replace Detectable Warning System. Grind Gutter Lip.

Surveyor Notes:

CONSTRUCTION

PROW/ADA:

R305.1.4, R305.2, R302.7.2

Street 1 Name	E 17TH ST
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1000.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	56.0	Yes	Grade Break Slope (%)	4.1
Yes	Ramp Slope (%)	4.7	Yes	Grade Break XSlope (%)	1.7
Yes	Ramp XSlope (%)	0.6			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	4.5
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	11.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.8
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	No		Road Slope (%)	0.7
	X Walk 1 Direction	To NE		Road X Slope (%)	2.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.7

