


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 5714	Main Street: JOHN_KIRK_DR	Cross Street: UNIVERSITY_CITY_BV	Location:	W
ADA ID: 1ED970B0581F	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

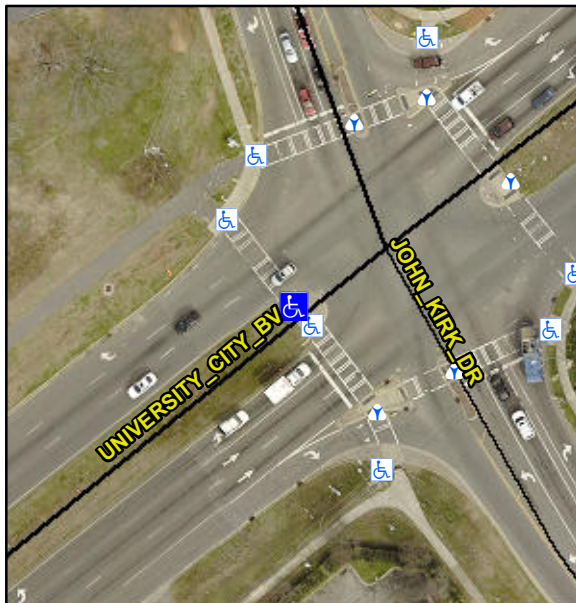

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

RP < 5%

PROW/ADA:

**R304.2.3, R305.2, R302.7, R304.5.4,
R304.5.3**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	36.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	96.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	3.1	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	0.4			
No	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	69.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	96.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	25.0
Yes	Landing X Slope (%)	0.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	10.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	30.0
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	7.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.4
	X Walk 1 Direction	To NW		Road X Slope (%)	0.7
	X Walk 1 Width (in)	108.0		Clear Space?	Yes
	X Walk 1 Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.7	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.2

