


Intersection ID: 23090	Main Street: CHALYCE_LN	Cross Street: LYNBRIDGE_DR	Location:	NE
ADA ID: 1FD5EDF25400	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance						
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	33.0	Yes	Ramp Slope (%)	6.7	
			No	Ramp Width (in)	42.0	No	Ramp XSlope (%)	7.9	
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
	Surveyor Notes:		N/A	N/A	N/A	N/A	N/A	N/A	N/A
	PROW/ADA:		N/A	N/A	N/A	N/A	N/A	N/A	N/A
	Not Found, R304.5.1, R304.5.3		N/A	N/A	N/A	N/A	N/A	N/A	N/A
Total Cost:		\$	3200.00	N/A	N/A	N/A	N/A	N/A	
					Yes	Surface Condition? (G/P)	Good		

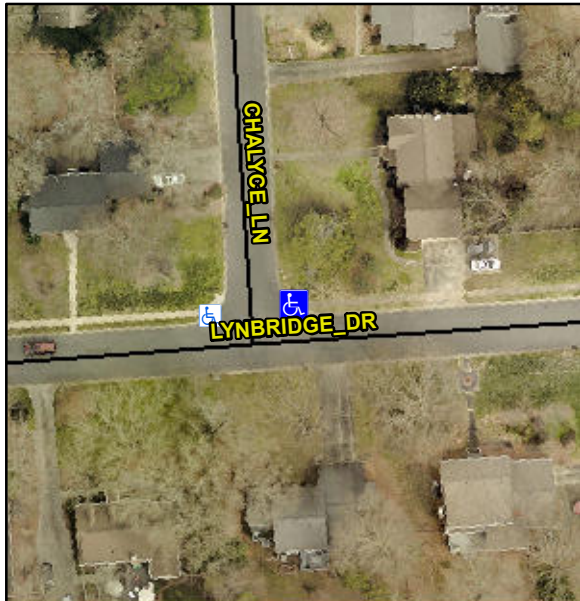