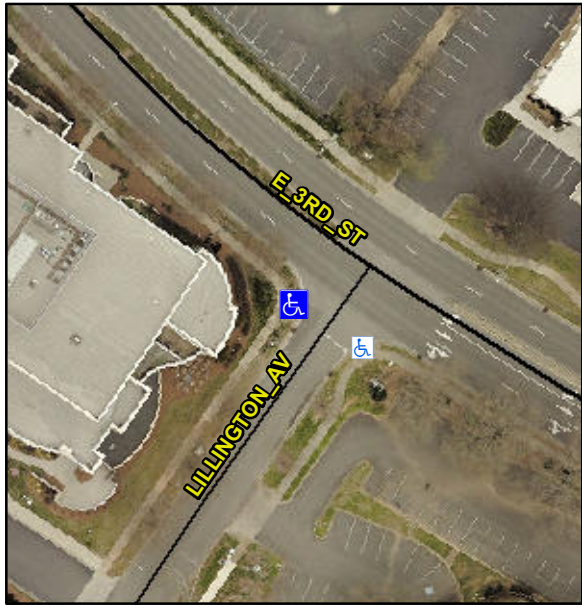


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 14202	Main Street: E_3RD_ST	Cross Street: LILLINGTON AV	Location: W
ADA ID: 20754A72199D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 18.75			

	Possible Solutions:		Compliance		Description		Data	Compliance	Description		Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	No	Ramp Length (in)	84.0	Yes	Ramp Slope (%)			7.8
					Ramp Width (in)	34.0	No	Ramp XSlope (%)			4.2
					Flare Type LT	N/A	N/A	Flare Type RT			N/A
					Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)			N/A
					Flare Traversable LT?	N/A	N/A	Flare Traversable RT?			N/A
					Landing Length (in)	N/A	N/A	DWS Provided?			N/A
					Landing Width (in)	N/A	N/A	DWS Contrast?			N/A
					Landing Slope (%)	N/A	N/A	DWS Length (in)			N/A
					Landing X Slope (%)	N/A	N/A	DWS Full Width?			N/A
Surveyor Notes:  N/A	PROW/ADA:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)			N/A
	R304.5.1, R304.5.3				Shared Landing?	N/A					
					Gutter Ponding?	N/A	N/A	Gutter Slope (%)			N/A
					Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)			N/A
					Painted X Walk1?	No	N/A	Painted X Walk2?			No
					X Walk 1 Direction	To SE		X Walk 2 Direction			To NE
					X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)			N/A
					X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)			0.9
					X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)			3.0
					Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?			N/A
Total Cost: \$ 3200.00					Road Slope (%)	2.2	N/A	Clear Space?			N/A
					Road X Slope (%)	0.5	N/A	Clear Space to XWalk (in)			N/A
					Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?			N/A
					Obstruction Type			Storm Grate/Utility Type			
						N/A					N/A
							Yes	Surface Condition? (G/P)			Good

