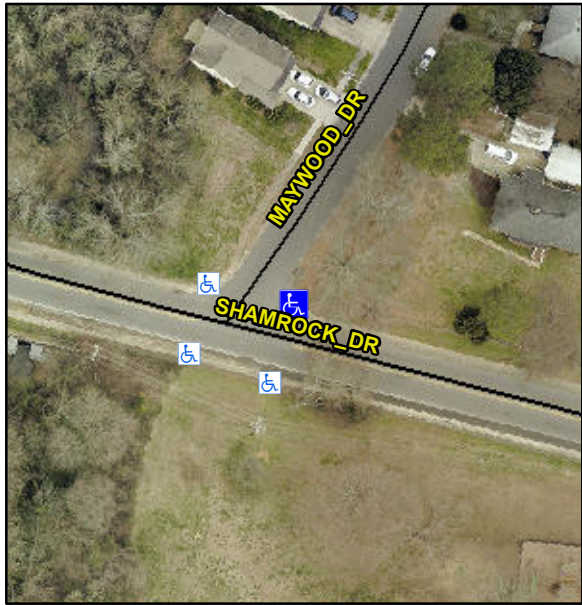


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11449	Main Street: MAYWOOD_DR	Cross Street: SHAMROCK_DR	Location: E
ADA ID: 2076553B478D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance								
	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Compliance	Description	Data	Compliance	Description	Data	
	Surveyor Notes:	N/A	PROW/ADA:	Not Found, R304.2.2, R304.5.3	N/A	Ramp Length (in)	46.0	No	Ramp Slope (%)	13.2
					Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.4
					N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
					N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Total Cost:	\$	3200.00	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A				Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A				Shared Landing?	N/A					
N/A				Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A				Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A				Painted X Walk1?	No	N/A	Painted X Walk2?	No		
			X Walk 1 Direction	To NW		X Walk 2 Direction	To SW			
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A					
			X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	4.3			
			X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	1.0			
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A					
			Road Slope (%)	0.8	N/A	Clear Space?	N/A			
			Road X Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A			
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A					
			Obstruction Type			Storm Grate/Utility Type				
					N/A		N/A			
							Yes	Surface Condition? (G/P)	Good	

