


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 51504	Main Street: DUNSLOW_CT	Cross Street: EASTFIELD_PARK_DR	Location:	N
ADA ID: 20CB17025770	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	5.9
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.6
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	4.7	N/A	Flare Slope RT (%)	0.5
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	58.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	3.4	Yes	DWS Full Width?	Yes
Surveyor Notes:			N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
PROW/ADA:			N/A	Shared Landing?	No			
Not Found, R304.5.3, R305.2			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.5
			Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.3
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	5.9		X Walk 2 Slope (%)	4.0
				X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	4.5
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	2.3	N/A	Clear Space?	Yes
				Road X Slope (%)	6.7	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3950.00						

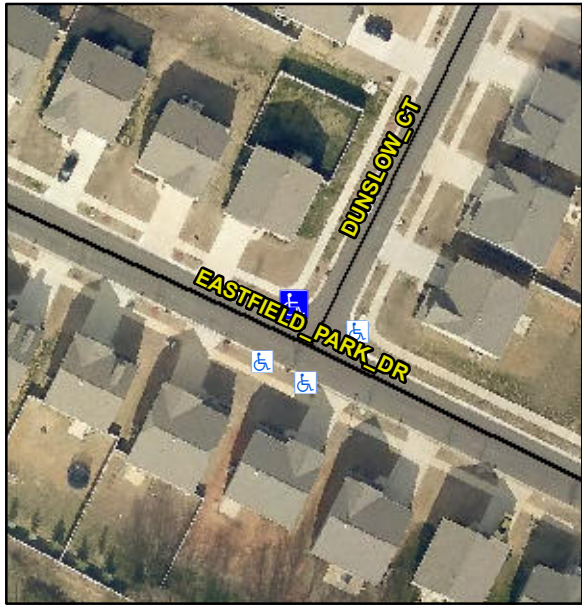