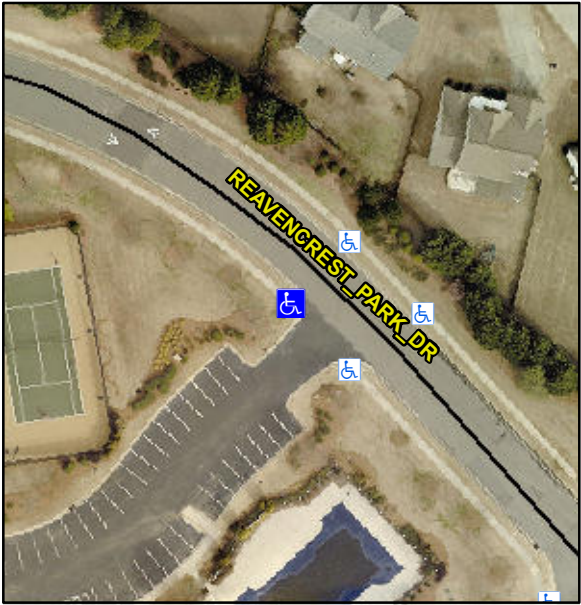


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10035606	Main Street: REAVENCREST_PARK_DR	Cross Street: N/A	Location: NW
ADA ID: 20E6BFF099BD	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 17.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	100.0	Yes
			No	Ramp Width (in)	32.0	Yes
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To SE	
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	0.3	
				X Walk 1 X Slope (%)	2.1	
			N/A	Ramp inside XWalk1?	N/A	N/A
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.1						
				Ramp Slope (%)	6.7	
				Ramp XSlope (%)	1.3	
				Flare Type RT	N/A	
				Flare Slope RT (%)	N/A	
				Flare Traversable RT?	N/A	
				DWS Provided?	N/A	
				DWS Contrast?	N/A	
				DWS Length (in)	N/A	
				DWS Full Width?	N/A	
				DWS Offset (in)	N/A	
				Gutter Slope (%)	N/A	
				Gutter X Slope (%)	N/A	
				Painted X Walk2?	No	
				X Walk 2 Direction	To NE	
				X Walk 2 Width (in)	N/A	
				X Walk 2 Slope (%)	2.9	
				X Walk 2 X Slope (%)	1.0	
				Ramp inside XWalk2?	N/A	
				Clear Space?	N/A	
				Clear Space to XWalk (in)	N/A	
				Storm Grate/Utility Hazard?	N/A	
				Storm Grate/Utility Type		
					N/A	N/A
				Surface Condition? (G/P)	Good	
Total Cost:		\$ 3200.00				

Street 1 Name	ENTRANCE
Stop Condition-Street 2	StopSign
Street 2 Name	REAVENCREST PARK DR
Stop Condition-Street 1	None

