


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29684	Main Street: CAMERON_CREEK_DR	Cross Street: HAMPTON_GLEN_CT	Location: N
ADA ID: 20F97236BBD2	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

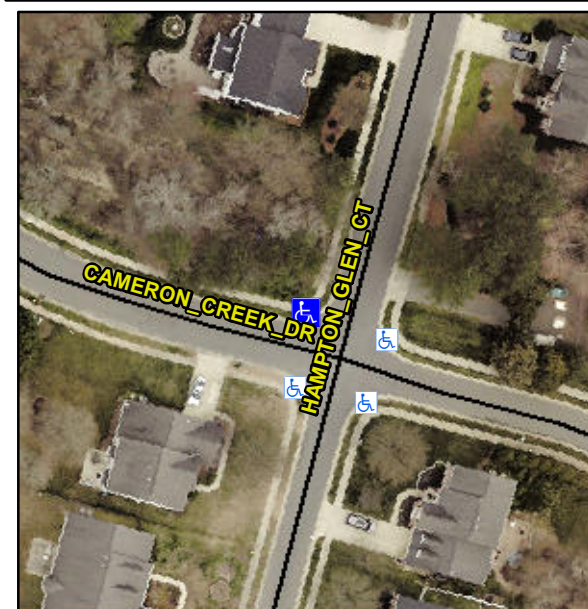

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.2.3, R305

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.5	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.6
No	Flare Type	Curbed_WithWalkSurface	No	Flare Type RT	N/A
No	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	44.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	4.3	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	6.6	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.3
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.6		X Walk 2 Slope (%)	1.2
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	2.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.4	N/A	Clear Space?	Yes
	Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

