

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

62.0

58.5

6.8

2.8

7.6

4.6

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: 48159 Main Street: MT_HOLLY-HUNTERSVILLE_RIDCross Street: NORTHLAKE_CENTRE_PY Location: SW

ADA ID: 211BB67EB991 Ramp Type: Combination1 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 10

Compliance Description

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

N/A

Yes

Yes

No

N/A

No

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

Yes

No

Yes

No

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Flare Traversable RT?

Ramp XSlope RT (%)

Data

50.0

60.5

7.0

3.2

48.0

46.5

N/A

N/A

N/A

N/A


N/A

N/A

N/A

N/A

N/A

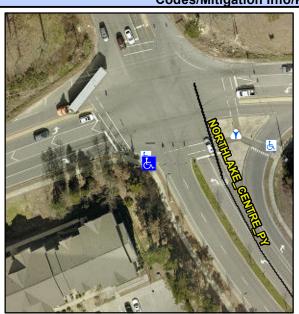

Street 1 Name
Signal
Stop Condition-Street 1 MT HOLLY HUNTERSVILLE RD
Street 2 Name
N/A
Stop Condition-Street 2 N/A

Possible Solutions:						
Remove & Replace Entire Ramp.						
·						
Sum rover Notes						
Surveyor Notes:						
N/A						
PROW/ADA:						
Not Found, R304.5.1, R304.5.3						
,						





Total Cost:



1800.00

N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	90.5		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	
					N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			l	Storm Grate/Utility Type	
					N/A
			Yes	Surface Condition? (G/P)	Good
	The same of the sa			Curb Slope (%)	9.8