


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10637	Main Street: COKER_AV	Cross Street: MATHIS_DR	Location: E
ADA ID: 21395B16DBCD	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 1.25			

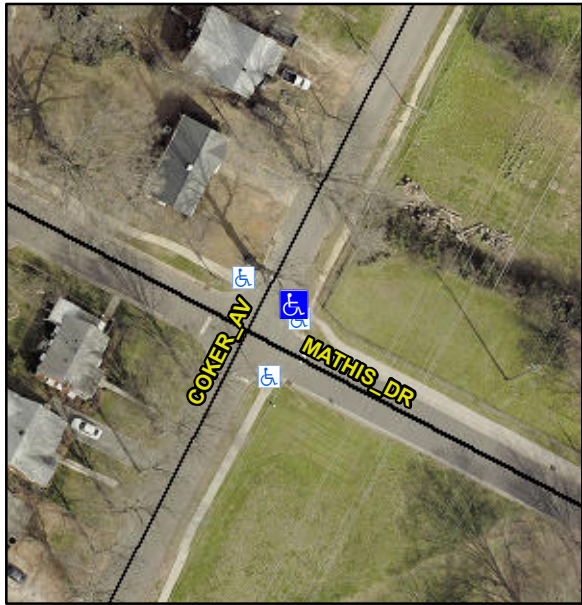

Street 1 Name

COKER AV

Stop Condition-Street 1

StopSign

Street 2 Name

N/A

Stop Condition-Street 2

N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Total Cost:

\$

1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	58.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	7.9	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	4.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	1.2
	X Walk 1 Direction	To NW		Road X Slope (%)	2.5
	X Walk 1 Width (in)	N/A		Clear Space?	N/A
	X Walk 1 Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.5	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
		N/A	N/A	Curb Slope (%)	12.9

Street 1 Name	COKER AV
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

