

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

102.0

58.0

9.2

1.6

6.3

1.0

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Main Street: N TRYON ST Cross Street: N/A Location: Intersection ID: 10016647 Ν

Ramp Type: Combination1 Initial Pass/Fail: Fail **Overall Compliance: No** ADA ID: 21E4F0E6C079 Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance Data

N/A

Yes

No

Yes

Yes

Yes

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A N/A

74.0

58.0

4.0

2.7

29.0

60.0

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Flare Traversable LT?

Ramp XSlope LT (%)

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp XSlope RT (%)

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?


DWS Length (in)

DWS Full Width?

DWS Offset (in)

Flare Traversable RT?

Flare Type RT

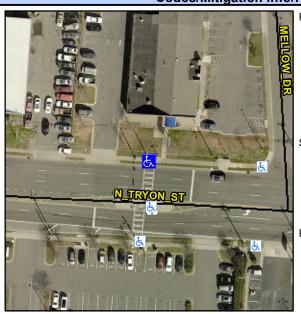

Street 1 Name Signal N TRYON ST Stop Condition-Street 1 Street 2 Name N/A Stop Condition-Street 2 N/A

OSSIDIE SOIULIOII		rieiu ivie
Possible Solutions:	Comp	liance Description
Remove & Replace Entire Ramp.	N/A	Ramp Length LT (in)
Remove & Replace Sidewalk.	Yes	Ramp Width LT (in)
	Yes	Ramp Slope LT (%)
	No	Ramp XSlope LT (%
	N/A	Ramp Length (in)
	Yes	Ramp Width (in)
Surveyor Notes:	N/A	Flare Type LT
SIGNAL UNDER CONSTRUCTION,	N/A	Flare Slope LT (%)
LT RP < 5%	N/A	Flare Traversable LT
	N/A	Landing Length (in)
	N/A	Landing Width (in)
PROW/ADA:	N/A	Landing Slope (%)
R304.5.3, R304.3.2	N/A	Landing X Slope (%)
·	N/A	Landing Curb? (Y/N)
	N/A	Shared Landing?
	N/A	Gutter Ponding?
	N/A	Gutter Lip Ht (in)
	N/A	Painted X Walk1?
		X Walk 1 Direction
		X Walk 1 Width (in)



Total Cost:



	N/A	Shared Landing?	N/A			
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
		X Walk 1 Direction	To S		X Walk 2 Direction	N/A
		X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	N/A
		X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	N/A
2200.00	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	N/A		Clear Space?	N/A
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Cach				N/A	Any Obstruction?	N/A
JEWELRY-T LS-1	ELECTRONICS	* PAWN *			Obstruction Type	
	-					N/A
				N/A	Storm Grate/Utility Hazard?	N/A
					Storm Grate/Utility Type	W/A
January	-					N/A
	TER.			Yes	Surface Condition? (G/P)	Good
					Curb Slope (%)	2.0

