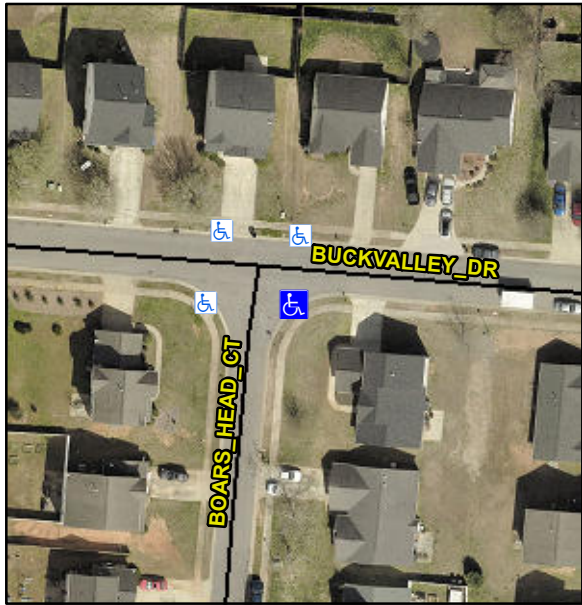


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29376	Main Street: BOARS_HEAD_CT	Cross Street: BUCKVALLEY_DR	Location:	SE
ADA ID: 21FA40A727F0	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	96.0	Yes	BlendTrans Slope (%)	4.8
			Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.5
			N/A	Flare Type LT	None	N/A	Flare Type RT	None
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	No	DWS Provided?	No
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R305</p>			N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.2
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To N		X Walk 2 Direction	To W
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	5.3		X Walk 2 Slope (%)	3.6
				X Walk 1 X Slope (%)	2.8		X Walk 2 X Slope (%)	6.4
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	1.5		Clear Space?	Yes	
			Road X Slope (%)	6.0	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
					Yes	Surface Condition? (G/P)	Good	
					No	Curb Slope (%)	12.4	

