


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 46815	Main Street: OLDE_IVY_WY	Cross Street: ARBOR_CREST_CT	Location: E
ADA ID: 2212E4D4BBEF	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.			N/A	Ramp Length (in)	46.5	Yes	Ramp Slope (%)	6.9
				No	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	1.4
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:			N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:			R304.5.1	N/A	Shared Landing?	N/A	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Ponding?	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
					X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	N/A
					X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	N/A
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)	N/A	N/A	Clear Space?	N/A
					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
					Obstruction Type			Storm Grate/Utility Type	
						N/A			N/A
							Yes	Surface Condition? (G/P)	Good
Total Cost:			\$ 1850.00						
Street 1 Name				ARBOR CREST CT					
Stop Condition-Street 2				None					
Street 2 Name				N/A					
Stop Condition-Street 1				N/A					

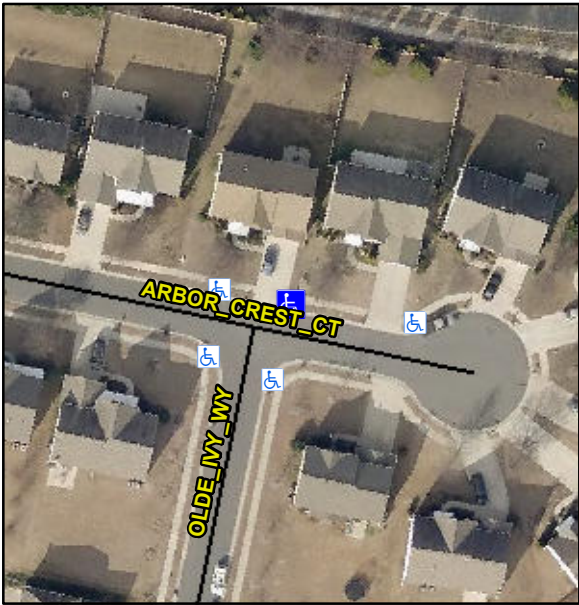