


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

|                        |                            |                           |                        |
|------------------------|----------------------------|---------------------------|------------------------|
| Intersection ID: 21431 | Main Street: WOODSTREAM_DR | Cross Street: WRENTREE_DR | Location: NW           |
| ADA ID: 225F8B581916   | Ramp Type: Directional1    | Initial Pass/Fail: Fail   | Overall Compliance: No |
|                        |                            | Severity Score: 12.5      |                        |

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

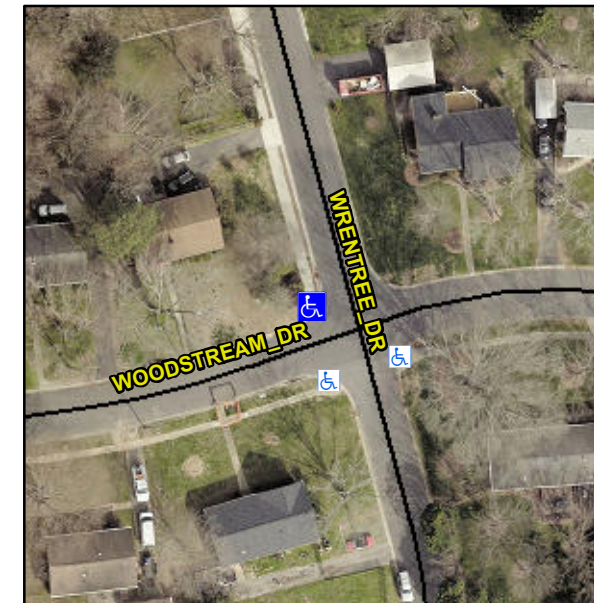

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3**

Total Cost:

\$ 1600.00

| Compliance | Description           | Data  | Compliance | Description                 | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 41.0  | N/A        | Grade Break?                | N/A  |
| Yes        | Ramp Width (in)       | 68.0  | N/A        | Grade Break Slope (%)       | 0.0  |
| Yes        | Ramp Slope (%)        | 7.0   | N/A        | Grade Break XSlope (%)      | 0.0  |
| No         | Ramp XSlope (%)       | 5.2   |            |                             |      |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | 0.0  |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)   | 0.0   | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)    | 0.0   | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)     | 0.0   | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)   | 0.0   | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset LT (in)          | N/A  |
| N/A        | Shared Landing?       | N/A   | N/A        | DWS Offset RT (in)          | N/A  |
| N/A        | Gutter Ponding?       | 0.0   | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)    | 0.0   | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?      | No    |            | Road Slope (%)              | 10.3 |
|            | X Walk 1 Direction    | To SE |            | Road X Slope (%)            | 0.3  |
|            | X Walk 1 Width (in)   | N/A   |            | Clear Space?                | N/A  |
|            | X Walk 1 Slope (%)    | 10.3  | N/A        | Clear Space to XWalk (in)   | N/A  |
|            | X Walk 1 X Slope (%)  | 0.3   | N/A        | Storm Grate/Utility Hazard? | N/A  |
| N/A        | Ramp inside XWalk1?   | N/A   |            | Storm Grate/Utility Type    |      |
| N/A        | Any Obstructions?     | N/A   |            |                             | N/A  |
|            | Obstruction Type      |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                       |       | N/A        | Curb Slope (%)              | 23.6 |

|                         |               |
|-------------------------|---------------|
| Street 1 Name           | WOODSTREAM DR |
| Stop Condition-Street 1 | None          |
| Street 2 Name           | N/A           |
| Stop Condition-Street 2 | N/A           |

