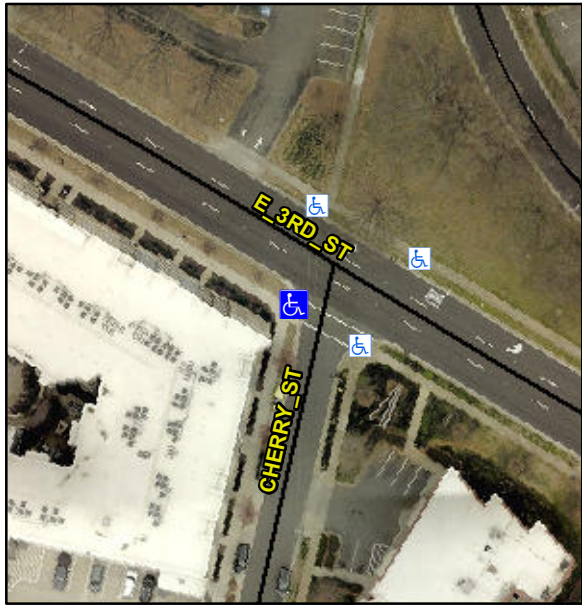


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13769	Main Street: E_3RD_ST	Cross Street: CHERRY_ST	Location: SW
ADA ID: 22B3490C83C0	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.						
	Surveyor Notes:						
	N/A						
	PROW/ADA:						
	Not Found, R304.2.2						
		Compliance	Description	Data	Compliance	Description	Data
		Description	Data	Description	Data		
		N/A	Ramp Length (in)	80.0	No	Ramp Slope (%)	8.6
		Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.2
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
	N/A	Shared Landing?	N/A				
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
	N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No	
		X Walk 1 Direction	To SE		X Walk 2 Direction	To NE	
	N/A	X Walk 1 Width (in)	111.5	N/A	X Walk 2 Width (in)	N/A	
		X Walk 1 Slope (%)	4.2		X Walk 2 Slope (%)	3.9	
		X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	2.2	
	N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A	
		Road Slope (%)	0.2	N/A	Clear Space?	N/A	
		Road X Slope (%)	4.0	N/A	Clear Space to XWalk (in)	N/A	
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
		Obstruction Type			Storm Grate/Utility Type		
			N/A			N/A	
				Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	3200.00				

