

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

8.5

2.7

N/A

Intersection ID: 27355 Main Street: JOHNSTON\_RD Cross Street: BRIXHAM HILL AV Location: SW **Overall Compliance: No** ADA ID: 22C01C70165E Ramp Type: Perp Initial Pass/Fail: Fail Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

25.0 No

48.0 Yes


N/A N/A

Data Compliance Description

Ramp Slope (%)

Ramp XSlope (%)

Flare Type RT

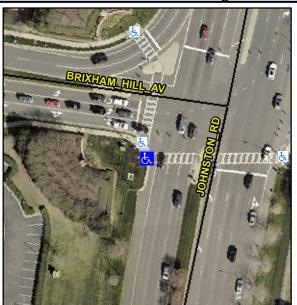

Possible Solutions:	Compliance Description
Remove & Replace Entire Ramp.	N/A Ramp Length (in)
, , , , , , , , , , , , , , , , , , ,	Yes Ramp Width (in)
	N/A Flare Type LT
	N/A Flare Slope LT (%)
	N/A Flare Traversable I
	N/A Landing Length (in
Surveyor Notes:	N/A Landing Width (in)
N/A	N/A Landing Slope (%)
	N/A Landing X Slope (%
	N/A Landing Curb? (Y/I
	N/A Shared Landing?
PROW/ADA:	N/A Gutter Ponding?
Not Found, R304.2.2	N/A Gutter Lip Ht (in)
,	N/A Painted X Walk1?
	X Walk 1 Direction
	N/A X Walk 1 Width (in
	X Walk 1 Slope (%
	X Walk 1 X Slope (
	N/A Ramp inside XWall
	Road Slope (%)





The state of the s	A STATE OF THE PARTY OF THE PAR								
BRIXHAM HILL AV				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
177 20				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
6.		Surveyor Notes:		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
<b>、                                    </b>	យា <b>នឹ</b> ក្រការសិទ្ធិ	N/A		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
п				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PS CEEK A	6			N/A	Shared Landing?	N/A			
		PROW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		Not Found, R304.2.2		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		·		N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
Here will be	I FULL				X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	The state of			N/A	X Walk 1 Width (in)	111.0	N/A	X Walk 2 Width (in)	N/A
treet 1 Name	<b>JOHNSTON RD</b>				X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A
top Condition-Street 2	Signal				X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	N/A
treet 2 Name	N/A			N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
top Condition-Street 1	N/A				Road Slope (%)	N/A	N/A	Clear Space?	N/A
					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Total Cost:	\$ 1850.00		Obstruction Type			Storm Grate/Utility Type	
						N/A			N/A
							Yes	Surface Condition? (G/P)	Good