

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: ALBERMARLE RD	Cross Street: CIRCUMFERENTIAL RD	Location: NE
ADA ID: 23AF15E52735	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

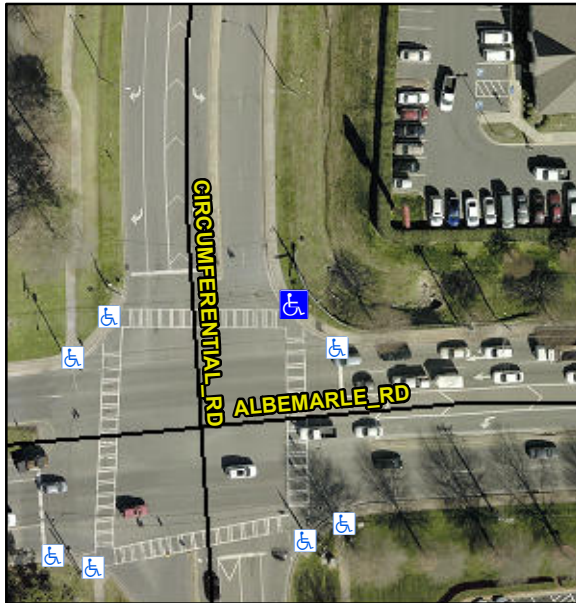

Possible Solutions:

Remove & Replace Landing.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para

Street 1 Name **CIRCUMFERENTIAL RD**
 Stop Condition-Street 1 **Signal**
 Street 2 Name **ALBERMARLE RD**
 Stop Condition-Street 2 **Signal**

Total Cost: \$ **500.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	60.0	N/A	Ramp Length RT (in)	56.0
Yes	Ramp Width LT (in)	58.0	Yes	Ramp Width RT (in)	59.0
Yes	Ramp Slope LT (%)	5.5	Yes	Ramp Slope RT (%)	4.6
Yes	Ramp XSlope LT (%)	1.9	Yes	Ramp XSlope RT (%)	1.3
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	52.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	103.0	N/A	X Walk 2 Width (in)	101.0
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	2.2
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	0.0
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.3	N/A	Clear Space?	Yes
	Road X Slope (%)	2.3	Yes	Clear Space to XWalk (in)	89.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Compliant	Curb Slope (%)	6.9

