


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 18259Main Street:OLD\_PINEVILLE\_RDCross Street:ROUNTREE\_RDLocation:SWADA ID: 23AFB0F147AERamp Type:ParaDiagInitial Pass/Fail:PassOverall Compliance:NoSeverity Score:0.25

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

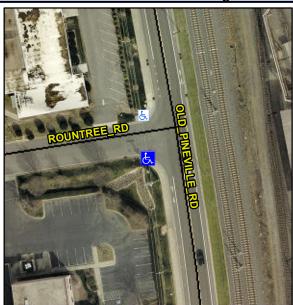

Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

OLD PINEVILLE RD
None
ROUNTREE RD
StopSign

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.2

Total Cost: \$ 3200.00

Comp	liance Description	Data	Compliance Description		Data
N/A	Ramp Length LT (in)	66.0	N/A	Ramp Length RT (in)	51.5
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	6.2	Yes	Ramp Slope RT (%)	5.9
Yes	Ramp XSlope LT (%)	0.8	No	Ramp XSlope RT (%)	2.9
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	2.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	0.0
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5	N/A	Clear Space?	Yes
	Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	13.9
			-		





