


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 10014712	Main Street: NORLAND_RD	Cross Street: N/A	Location:	N
ADA ID: 23D556704A2F	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 12.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	Compliance	Description	Data	Compliance	Description	Data
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2</p>		N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	10.6
		Yes	Ramp Width (in)	49.0	Yes	Ramp XSlope (%)	1.3
<p>Street 1 Name</p> <p>ENTRANCE</p> <p>Stop Condition-Street 2</p> <p>None</p> <p>Street 2 Name</p> <p>NORLAND RD</p> <p>Stop Condition-Street 1</p> <p>None</p>		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	1.7
			X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	1.2
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	0.7	N/A	Clear Space?	N/A
			Road X Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
				N/A			N/A
					Yes	Surface Condition? (G/P)	Good

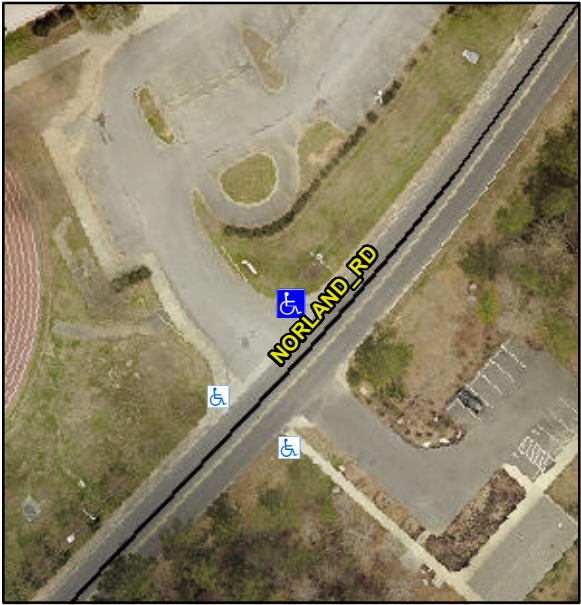