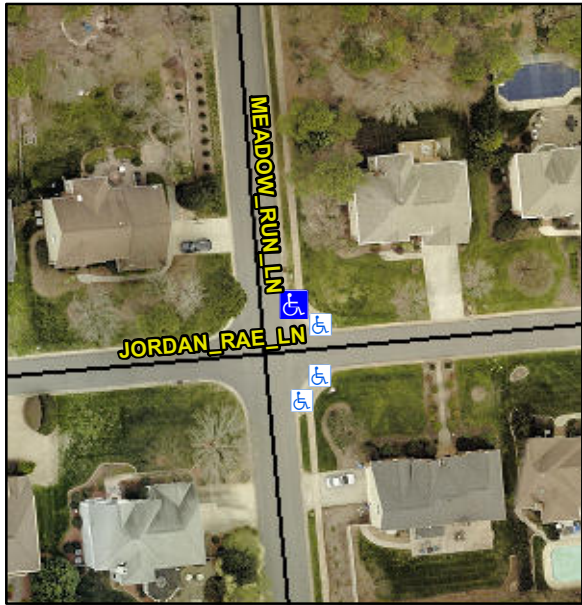


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27369	Main Street: JORDAN_RAE_LN	Cross Street: MEADOW_RUN_LN	Location: NE
ADA ID: 24485C589DA7	Ramp Type: BlendTrans2	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance						
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	96.0	Yes	BlendTrans Slope (%)	3.8	
			No	Ramp Width (in)	39.0	Yes	BlendTrans XSlope (%)	1.2	
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
Street 1 Name	MEADOW RUN LN		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
	Stop Condition-Street 1		None	N/A	Shared Landing?	N/A			
	Street 2 Name		N/A	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	Stop Condition-Street 2		N/A	N/A	N/A	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
					X Walk 1 Direction	To W		X Walk 2 Direction	N/A
					X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	N/A
					X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	N/A
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	0.1		Clear Space?	N/A	
				Road X Slope (%)	4.6	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A	
						Yes	Surface Condition? (G/P)	Good	
						No	Curb Slope (%)	9.4	

Total Cost: \$ 3200.00

