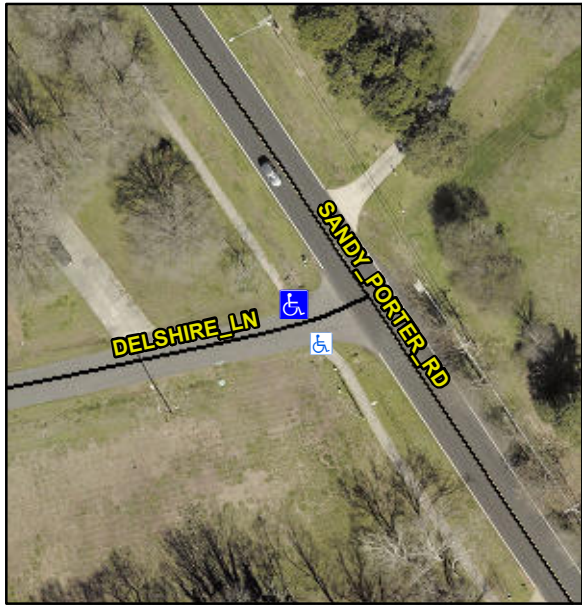


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 20975	Main Street: DELSHIRE_LN	Cross Street: SANDY_PORTER_RD	Location: W
ADA ID: 247871B1E40B	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		<b>Compliance</b>			<b>Description</b>			<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length (in)	<b>66.0</b>	<b>N/A</b>	Grade Break?	<b>N/A</b>		
			<b>Yes</b>	Ramp Width (in)	<b>64.0</b>	<b>N/A</b>	Grade Break Slope (%)	<b>0.0</b>		
			<b>Yes</b>	Ramp Slope (%)	<b>2.7</b>	<b>N/A</b>	Grade Break XSlope (%)	<b>0.0</b>		
			<b>No</b>	Ramp XSlope (%)	<b>3.3</b>					
			<b>N/A</b>	Flare Type LT	<b>N/A</b>	<b>N/A</b>	Flare Type RT	<b>N/A</b>		
			<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>	<b>N/A</b>	Flare Slope RT (%)	<b>0.0</b>		
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>	<b>N/A</b>	Flare Traversable RT?	<b>N/A</b>		
			<b>N/A</b>	Landing Length (in)	<b>0.0</b>	<b>N/A</b>	DWS Provided?	<b>N/A</b>		
			<b>N/A</b>	Landing Width (in)	<b>0.0</b>	<b>N/A</b>	DWS Contrast?	<b>N/A</b>		
		<b>N/A</b>	Landing Slope (%)	<b>0.0</b>	<b>N/A</b>	DWS Length (in)	<b>N/A</b>			
		<b>N/A</b>	Landing X Slope (%)	<b>0.0</b>	<b>N/A</b>	DWS Full Width?	<b>N/A</b>			
		<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>	<b>N/A</b>	DWS Offset LT (in)	<b>N/A</b>			
		<b>N/A</b>	Shared Landing?	<b>N/A</b>	<b>N/A</b>	DWS Offset RT (in)	<b>N/A</b>			
		<b>N/A</b>	Gutter Ponding?	<b>0.0</b>	<b>N/A</b>	Gutter Slope (%)	<b>N/A</b>			
		<b>N/A</b>	Gutter Lip Ht (in)	<b>0.0</b>	<b>N/A</b>	Gutter X Slope (%)	<b>N/A</b>			
		<b>N/A</b>	Painted X Walk1?	<b>No</b>		Road Slope (%)	<b>1.4</b>			
			X Walk 1 Direction	<b>To SE</b>		Road X Slope (%)	<b>2.7</b>			
			X Walk 1 Width (in)	<b>N/A</b>		Clear Space?	<b>N/A</b>			
			X Walk 1 Slope (%)	<b>1.4</b>	<b>N/A</b>	Clear Space to XWalk (in)	<b>N/A</b>			
			X Walk 1 X Slope (%)	<b>2.7</b>	<b>N/A</b>	Storm Grate/Utility Hazard?	<b>N/A</b>			
		<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>		Storm Grate/Utility Type				
		<b>N/A</b>	Any Obstructions?	<b>N/A</b>			<b>N/A</b>			
			Obstruction Type		<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>			
					<b>N/A</b>	Curb Slope (%)	<b>5.7</b>			
Surveyor Notes:										
<b>N/A</b>										
PROW/ADA:										
<b>R304.5.3</b>										
Total Cost:		<b>\$</b>	<b>1600.00</b>							
Street 1 Name		<b>DELSHIRE LN</b>								
Stop Condition-Street 1		<b>StopSign</b>								
Street 2 Name		<b>N/A</b>								
Stop Condition-Street 2		<b>N/A</b>								

