

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 23740 Main Street: PARK_RD Cross Street: SMITHFIELD_CHURCH_RD Location: SE

ADA ID: 2499D72F7175 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

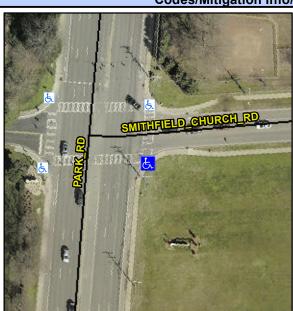

Street 1 Name
Stop Condition-Street 2
Signal
Street 2 Name
PARK RD
Stop Condition-Street 1
Signal

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

N

Surveyor Notes:

N/A

N

PROW/ADA:

R304.2.2, R304.5.3

Total Cost: \$ 3200.00

Compliance Description		Data		liance Description	Data
N/A	Ramp Length (in)	60.0	No	Ramp Slope (%)	9.9
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	5.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	109.0	N/A	X Walk 2 Width (in)	101.0
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	5.4
	X Walk 1 X Slope (%)	6.7		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	5.1	N/A	Clear Space?	N/A
	Road X Slope (%)	3.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A

Yes

Surface Condition? (G/P)

Good





