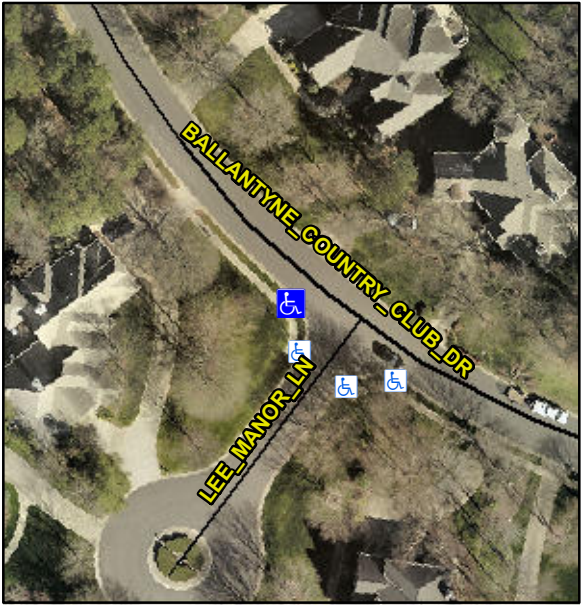


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 27687	Main Street: BALLANTYNE_COUNTRY_CLUB_DR	Cross Street: LEE MANOR_LN	Location: NW
ADA ID: 24A67628E6AF	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	Not Found, R304.2.2				
		Compliance	Description	Data	Compliance
		N/A	Ramp Length (in)	47.0	No
		Yes	Ramp Width (in)	49.0	Yes
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To NE	
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	3.3	
			X Walk 1 X Slope (%)	3.7	
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	N/A	N/A
			Road X Slope (%)	N/A	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P)
					Good

Street 1 Name	BALLANTYNE COUNTRY CLUB DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 1850.00

