

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 47463	Main Street: DOMINION_VILLAGE_DR	Cross Street: DOMINION_GREEN_DR	Location: SE
ADA ID: 2575D7D42C12	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

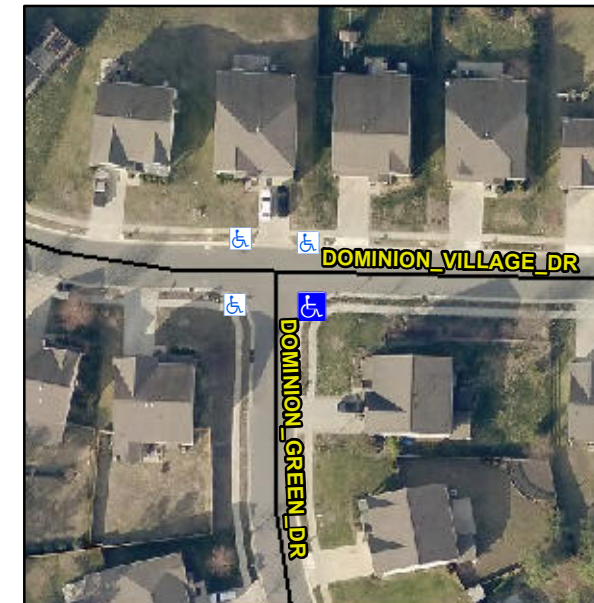

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	BlendTrans Slope (%)	2.4
No	Ramp Width (in)	46.5	No	BlendTrans XSlope (%)	5.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.3	N/A	Flare Slope RT (%)	9.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	47.5	N/A	DWS Provided?	Yes
N/A	Landing Width (in)	46.5	N/A	DWS Contrast?	Yes
N/A	Landing Slope (%)	2.5	N/A	DWS Length (in)	48.0
N/A	Landing X Slope (%)	2.4	N/A	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	5.5
N/A	Shared Landing?	No			
N/A	Gutter Ponding?	No	N/A	Gutter Slope (%)	5.5
N/A	Gutter Lip Ht (in)	0.3	N/A	Gutter X Slope (%)	3.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	6.9
	X Walk 1 X Slope (%)	6.6		X Walk 2 X Slope (%)	3.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6		Clear Space?	Yes
	Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	No	N/A	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	12.2

Street 1 Name DOMINION VILLAGE DR

Stop Condition-Street 1 None

Street 2 Name DOMINION GREEN DR

Stop Condition-Street 2 StopSign

