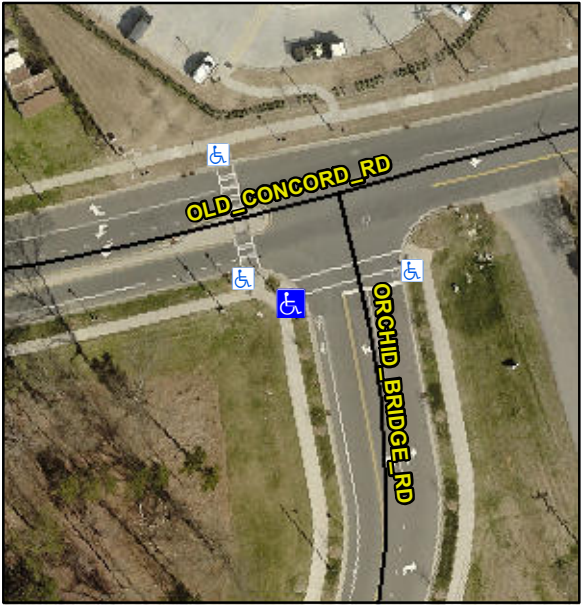


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: OLD_CONCORD_RD	Cross Street: ORCHID_BRIDGE_RD	Location: SW
ADA ID: 2623ADFF2D4F	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 1.25			

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes:						
	N/A						
	PROW/ADA:						
	R304.5.3						
	Street 1 Name	ORCHID BRIDGE RD					
	Stop Condition-Street 2	StopSign					
	Street 2 Name	N/A					
	Stop Condition-Street 1	N/A					
Total Cost:		\$ 1850.00					
				Compliance	Description	Data	Compliance
				Description			Description
				Data			Data
				N/A	Ramp Length (in)	97.0	Yes
				Yes	Ramp Width (in)	48.0	No
				N/A	Flare Type LT	N/A	N/A
				N/A	Flare Slope LT (%)	N/A	N/A
				N/A	Flare Traversable LT?	N/A	N/A
				N/A	Landing Length (in)	N/A	N/A
				N/A	Landing Width (in)	N/A	N/A
				N/A	Landing Slope (%)	N/A	N/A
				N/A	Landing X Slope (%)	N/A	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A
				N/A	Shared Landing?	N/A	
				N/A	Gutter Ponding?	N/A	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A
				N/A	Painted X Walk1?	Yes	N/A
					X Walk 1 Direction	To E	
				N/A	X Walk 1 Width (in)	94.0	N/A
					X Walk 1 Slope (%)	1.0	
					X Walk 1 X Slope (%)	3.6	
				N/A	Ramp inside XWalk1?	Yes	N/A
					Road Slope (%)	N/A	N/A
					Road X Slope (%)	N/A	N/A
				N/A	Any Obstructions?	N/A	N/A
					Obstruction Type		
						N/A	N/A
				Yes	Surface Condition? (G/P)		Good

