


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5563	Main Street: N I-77 EXIT 16 RA	Cross Street: REAMES_RD	Location: SE
ADA ID: 26510B1DBAB1	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 0.25			

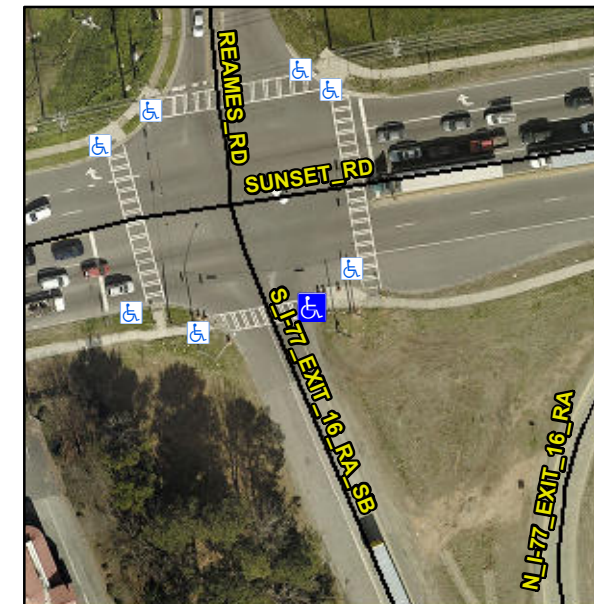

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

NO CURB

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	108.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	72.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	1.9	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	2.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	2.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	19.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.2
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.9
N/A	Painted X Walk1?	No		Road Slope (%)	3.8
	X Walk 1 Direction	To W		Road X Slope (%)	1.3
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.3	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name N I-77 EXIT 16 RA
Stop Condition-Street 1 Signal
Street 2 Name N/A
Stop Condition-Street 2 N/A

