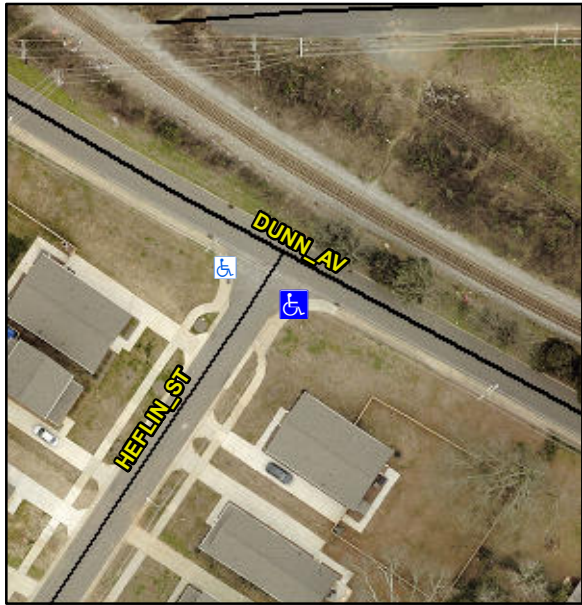


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                        |                      |                         |                        |
|------------------------|----------------------|-------------------------|------------------------|
| Intersection ID: 15108 | Main Street: DUNN_AV | Cross Street: HEFLIN_ST | Location: S            |
| ADA ID: 266779E20FA4   | Ramp Type: ParaDiag  | Initial Pass/Fail: Fail | Overall Compliance: No |
|                        |                      | Severity Score: 8.75    |                        |

| Codes/Mitigation Info/Possible Solution  |   |            | Field Measurements/Component Compliance |                      |       |            |                             |       |
|--|---|------------|---|----------------------|-------|------------|-----------------------------|-------|
|  | Possible Solutions:   |            | Compliance                              | Description          | Data  | Compliance | Description                 | Data  |
|  | <b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b> |            | N/A                                     | Ramp Length LT (in)  | 38.0  | N/A        | Ramp Length RT (in)         | 38.0  |
|  |   |            | No                                      | Ramp Width LT (in)   | 45.0  | No         | Ramp Width RT (in)          | 47.0  |
|  |   |            | Yes                                     | Ramp Slope LT (%)    | 3.0   | Yes        | Ramp Slope RT (%)           | 6.1   |
|  |   |            | Yes                                     | Ramp XSlope LT (%)   | 1.1   | Yes        | Ramp XSlope RT (%)          | 0.5   |
|  |   |            | N/A                                     | Landing Length (in)  | N/A   | N/A        | DWS Provided?               | N/A   |
|  |   |            | N/A                                     | Landing Width (in)   | N/A   | N/A        | DWS Contrast?               | N/A   |
|  |   |            | N/A                                     | Landing Slope (%)    | N/A   | N/A        | DWS Length (in)             | N/A   |
|  |   |            | N/A                                     | Landing X Slope (%)  | N/A   | N/A        | DWS Full Width?             | N/A   |
|  |   |            | N/A                                     | Landing Curb? (Y/N)  | N/A   | N/A        | DWS Offset (in)             | N/A   |
| Surveyor Notes:  |   |            | N/A                                     | Shared Landing?      | N/A   |            |                             |       |
| <b>LT RP &lt; 5%</b>   |   |            | N/A                                     | Gutter Ponding?      | N/A   | N/A        | Gutter Slope (%)            | N/A   |
| PROW/ADA:  |   |            | N/A                                     | Gutter Lip Ht (in)   | N/A   | N/A        | Gutter X Slope (%)          | N/A   |
| <b>R304.5.1</b>  |   |            | N/A                                     | Painted X Walk1?     | No    | N/A        | Painted X Walk2?            | No    |
|  |   |            |   | X Walk 1 Direction   | To NW |            | X Walk 2 Direction          | To NE |
|  |   |            | N/A                                     | X Walk 1 Width (in)  | N/A   | N/A        | X Walk 2 Width (in)         | N/A   |
|  |   |            |   | X Walk 1 Slope (%)   | 3.1   |            | X Walk 2 Slope (%)          | 0.2   |
|  |   |            |   | X Walk 1 X Slope (%) | 3.8   |            | X Walk 2 X Slope (%)        | 3.2   |
|  |   |            | N/A                                     | Ramp inside XWalk1?  | N/A   | N/A        | Ramp inside XWalk2?         | N/A   |
|  |   |            |   | Road Slope (%)       | 2.4   | N/A        | Clear Space?                | N/A   |
|  |   |            |   | Road X Slope (%)     | 1.1   | N/A        | Clear Space to XWalk (in)   | N/A   |
|  |   |            | N/A                                     | Any Obstructions?    | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A   |
|  |   |            |   | Obstruction Type     |       |            | Storm Grate/Utility Type    |       |
|  |   |            |   |                      | N/A   |            |                             | N/A   |
|  |   |            |   |                      |       | Yes        | Surface Condition? (G/P)    | Good  |
|  |   |            |   |                      |       | N/A        | Curb Slope (%)              | 7.4   |
| Total Cost:  |   | \$ 3200.00 |   |                      |       |            |                             |       |

