


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 29916	Main Street: NORTHRIDGE_DR	Cross Street: WILDBROOK_DR	Location: NE
ADA ID: 26837C758AE7	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.					
	Surveyor Notes:	N/A					
	PROW/ADA:	R304.5.1, R304.5.3					
	Street 1 Name	WILDBROOK DR					
	Stop Condition-Street 2	None					
	Street 2 Name	NORTHRIDGE DR					
	Stop Condition-Street 1	StopSign					
	Total Cost:	\$ 3200.00					
Compliance	Description	Data	Compliance	Description	Data		
N/A	Ramp Length (in)	51.0	Yes	Ramp Slope (%)	6.9		
No	Ramp Width (in)	44.0	No	Ramp XSlope (%)	7.2		
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
	X Walk 1 Direction	To W		X Walk 2 Direction	To S		
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	5.6		
	X Walk 1 X Slope (%)	6.0		X Walk 2 X Slope (%)	3.4		
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	5.5	N/A	Clear Space?	N/A		
	Road X Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm Grate/Utility Type			
			N/A		N/A		
			Yes	Surface Condition? (G/P)	Good		

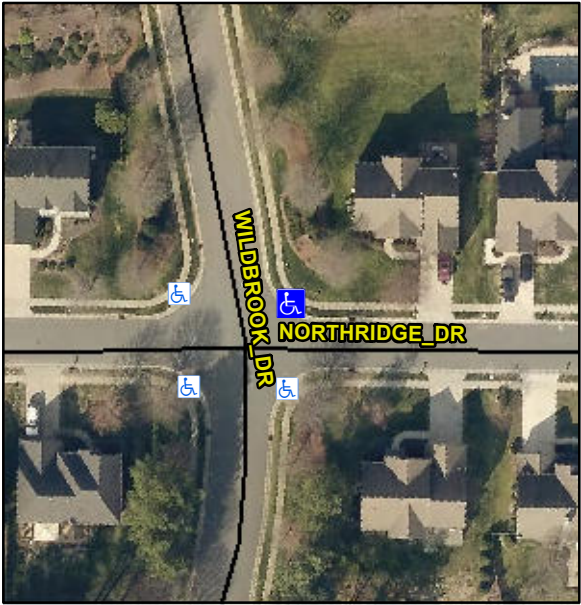