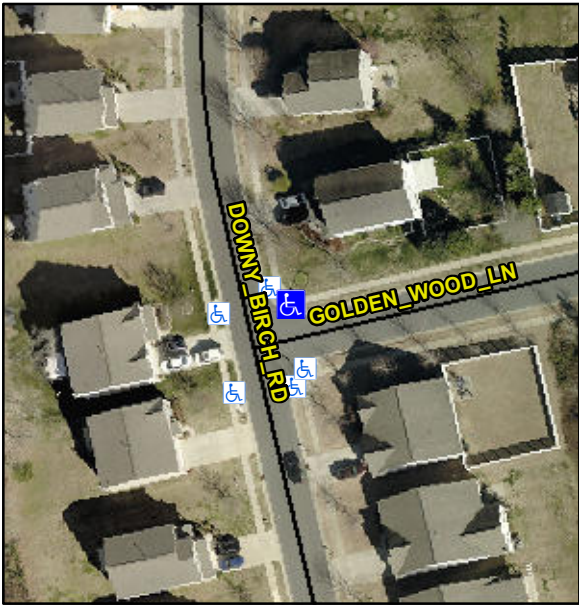


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 50610	Main Street: GOLDEN_WOOD_LN	Cross Street: DOWNY_BIRCH_RD	Location: NE
ADA ID: 27F30BA8DD8E	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.			N/A	Ramp Length (in)	47.5	No	Ramp Slope (%)	9.0
				Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.8
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	N/A
PROW/ADA:			N/A	Shared Landing?	N/A				
Not Found, R304.2.2, R304.5.3			N/A	Gutter Ponding?	N/A	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To S			X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	5.5			X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	2.1			X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	N/A	Clear Space?	N/A
				Road X Slope (%)	N/A	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type				Storm Grate/Utility Type	
						N/A			N/A
							Yes	Surface Condition? (G/P)	Good
Total Cost:			\$	1850.00					

Street 1 Name	GOLDEN WOOD LN
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

