


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 4743 Main Street: BELLHAVEN BV Cross Street: MT HOLLY-HUNTERSVILLE RD Location: ADA ID: 2834AA6C9074 Ramp Type: BlendTrans2 Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 8.75

Codes/Mitigation Info/Possible Solution

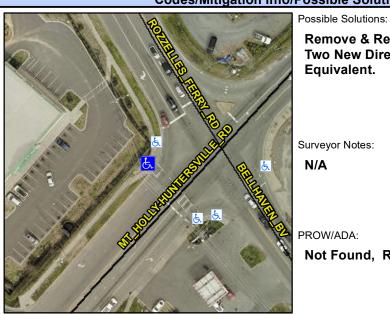

MT HOLLY HUNTERSVILLE RD Street 1 Name Stop Condition-Street 1 Signal Street 2 Name N/A Stop Condition-Street 2 N/A Remove & Replace Curb Ramp With **Two New Directional Ramps or** Equivalent.

N/A

PROW/ADA:

Not Found, R304.5.1





Total Cost:



3200.00

Field Measurements/Component Compliance					
Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length (in)	59.0	Yes	BlendTrans Slope (%)	4.3
No	Ramp Width (in)	47.0	Yes	BlendTrans XSlope (%)	0.8
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	110.5		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.3		Clear Space?	N/A
	Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	7.4