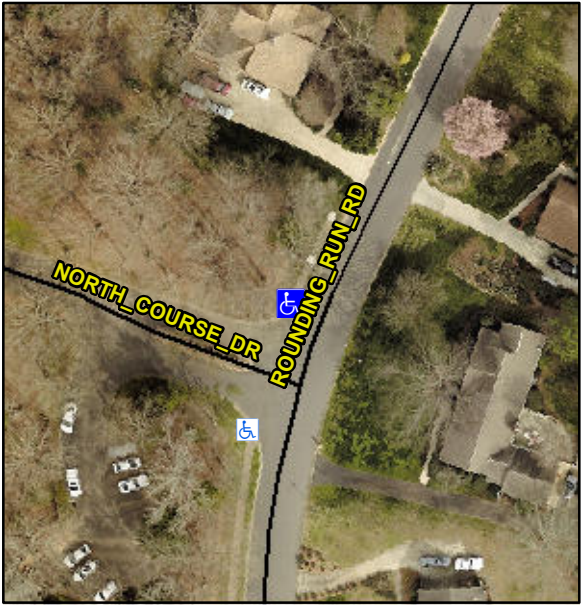


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 26040	Main Street: NORTH_COURSE_DR	Cross Street: ROUNDING_RUN_RD	Location: NE
ADA ID: 286A4EED9F21	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	Not Found, R304.2.2, R304.5.3				
	Street 1 Name	NORTH COURSE DR		Stop Condition-Street 2	StopSign
	Street 2 Name	ROUNDING RUN RD		Stop Condition-Street 1	None
	Total Cost:	\$	3200.00		
		Compliance	Description	Data	Compliance
		N/A	Ramp Length (in)	48.0	No
		Yes	Ramp Width (in)	48.0	No
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	N/A
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To SW	X Walk 2 Direction
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	6.9	X Walk 2 Slope (%)
			X Walk 1 X Slope (%)	4.7	X Walk 2 X Slope (%)
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	5.5	N/A
			Road X Slope (%)	1.1	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P)
					Good

