


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10032880Main Street: NATIONS_FORD_RDCross Street: N/ALocation:NEADA ID: 29CCE050DA36Ramp Type: ParaDiagInitial Pass/Fail: FailOverall Compliance: NoSeverity Score: 26.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

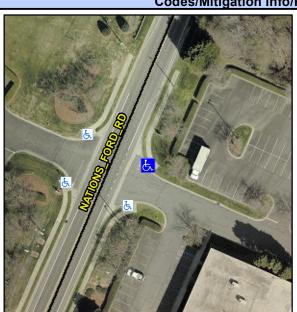

Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

NATIONS FORD RD
None
ENTRANCE
StopSign

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.3.2, R304.5.3

Total Cost: \$ 3200.00

Field Measurements/Component Compliance					
Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length LT (in)	55.0	N/A	Ramp Length RT (in)	59.0
Yes	Ramp Width LT (in)	107.0	Yes	Ramp Width RT (in)	107.0
Yes	Ramp Slope LT (%)	2.2	No	Ramp Slope RT (%)	12.1
Yes	Ramp XSlope LT (%)	1.9	No	Ramp XSlope RT (%)	3.0
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	8.6
	X Walk 1 X Slope (%)	6.3		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	5.8	N/A	Clear Space?	N/A
	Road X Slope (%)	5.4	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
	• •	N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.8
			•	1 ()	





