


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                          |                         |                                         |
|-----------------------------------------|--------------------------|-------------------------|-----------------------------------------|
| Intersection ID: 8573                   | Main Street: N_GRAHAM_ST | Cross Street: ATANDO_AV | Location: NE                            |
| ADA ID: 2A27EBC2B987                    | Ramp Type: Para          | Initial Pass/Fail: Pass | Overall Compliance: No                  |
| Codes/Mitigation Info/Possible Solution |                          |                         | Severity Score: 0                       |
|                                         |                          |                         | Field Measurements/Component Compliance |

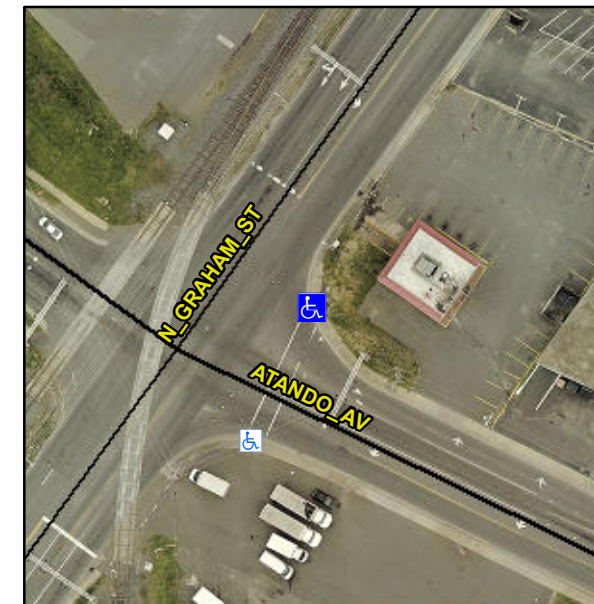

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp,  
R304.3.2-Para**

Total Cost: \$ 1600.00

| Compliance | Description          | Data  | Compliance | Description                 | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length LT (in)  | 62.0  | N/A        | Ramp Length RT (in)         | 63.0 |
| Yes        | Ramp Width LT (in)   | 59.5  | Yes        | Ramp Width RT (in)          | 59.5 |
| Yes        | Ramp Slope LT (%)    | 6.6   | Yes        | Ramp Slope RT (%)           | 4.7  |
| Yes        | Ramp XSlope LT (%)   | 1.8   | Yes        | Ramp XSlope RT (%)          | 1.7  |
| Yes        | Landing Length (in)  | 59.5  | Yes        | DWS Provided?               | Yes  |
| No         | Landing Width (in)   | 43.0  | Yes        | DWS Contrast?               | Yes  |
| No         | Landing Slope (%)    | 2.3   | Yes        | DWS Length (in)             | 25.0 |
| Yes        | Landing X Slope (%)  | 1.5   | Yes        | DWS Full Width?             | Yes  |
| N/A        | Landing Curb? (Y/N)  | No    | Yes        | DWS Offset (in)             | 1.0  |
| N/A        | Shared Landing?      | No    |            |                             |      |
| Yes        | Gutter Ponding?      | No    | Yes        | Gutter Slope (%)            | 2.0  |
| Yes        | Gutter Lip Ht (in)   | 0.0   | Yes        | Gutter X Slope (%)          | 0.7  |
| N/A        | Painted X Walk1?     | Yes   | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction   | To SW |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)  | 97.5  | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)   | 0.7   |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%) | 0.2   |            | X Walk 2 X Slope (%)        | N/A  |
| Yes        | Ramp inside XWalk1?  | Yes   | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)       | N/A   | N/A        | Clear Space?                | Yes  |
|            | Road X Slope (%)     | N/A   | N/A        | Clear Space to XWalk (in)   | N/A  |
| Yes        | Any Obstructions?    | No    | Yes        | Storm Grate/Utility Hazard? | No   |
|            | Obstruction Type     |       |            | Storm Grate/Utility Type    |      |
|            |                      | N/A   |            |                             | N/A  |
|            |                      |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                      |       | Replace    | Curb Slope (%)              | 29.1 |

