


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 50709	Main Street: ARRIVAL_DR	Cross Street: BROTHERLY_LN	Location: SE
ADA ID: 2A88D1CA322D	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 10.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

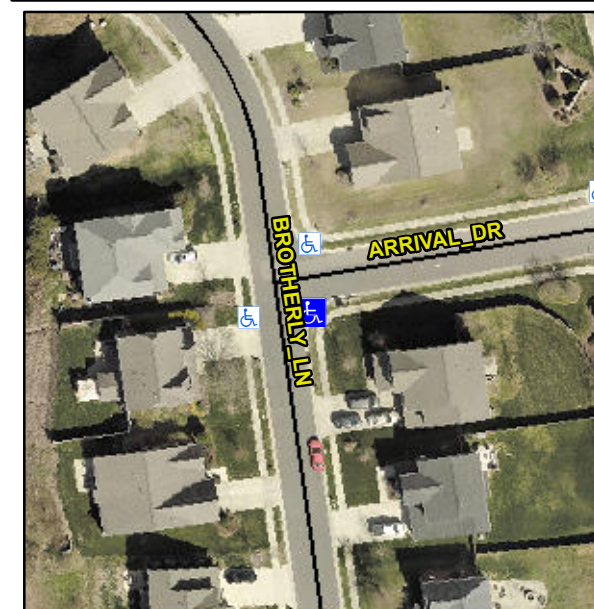

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	94.5	Yes	Ramp Slope (%)	6.7
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.6	Yes	Flare Slope RT (%)	7.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.8
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	0.1
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	3.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	5.1	N/A	Clear Space?	Yes
	Road X Slope (%)	2.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name ARRIVAL DR  
 Stop Condition-Street 2 StopSign  
 Street 2 Name BROTHERLY LN  
 Stop Condition-Street 1 None

