


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 23887	Main Street: FOXGLOVE_DR	Cross Street: REA_RD	Location: SW
ADA ID: 2AB69B59F7B5	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

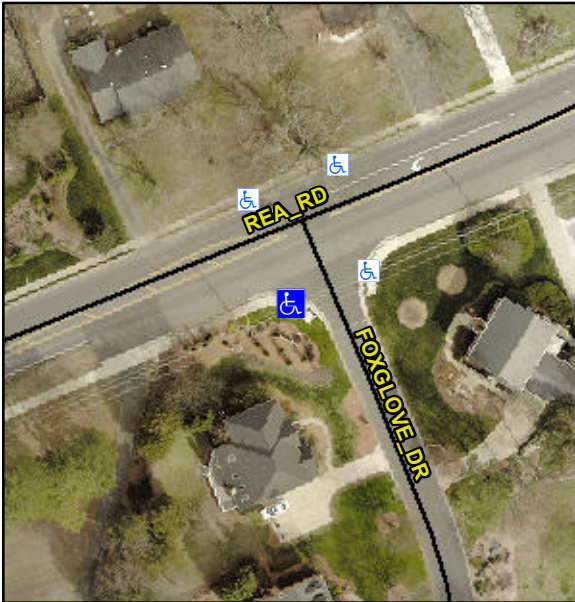

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	Ramp Slope (%)	6.5
Yes	Ramp Width (in)	69.0	Yes	Ramp XSlope (%)	1.6
Yes	Flare Type LCurbed_NoWalkSurface		N/A	Flare Type RT	N/A
Yes	Flare Slope LT (%)	N/A	Yes	Flare Slope RT (%)	9.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	2.8
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	1.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.7	N/A	Clear Space?	Yes
	Road X Slope (%)	1.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Street 1 Name	FOXGLOVE DR
Stop Condition-Street 2	StopSign
Street 2 Name	REA RD
Stop Condition-Street 1	None

