


Intersection ID: 19934	Main Street: W_ARROWWOOD_RD	Cross Street: WHITEWHITEHALL_EXECUTIVE_CENTER_DR	Location:	SW
ADA ID: 2B4AA6A700E7	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

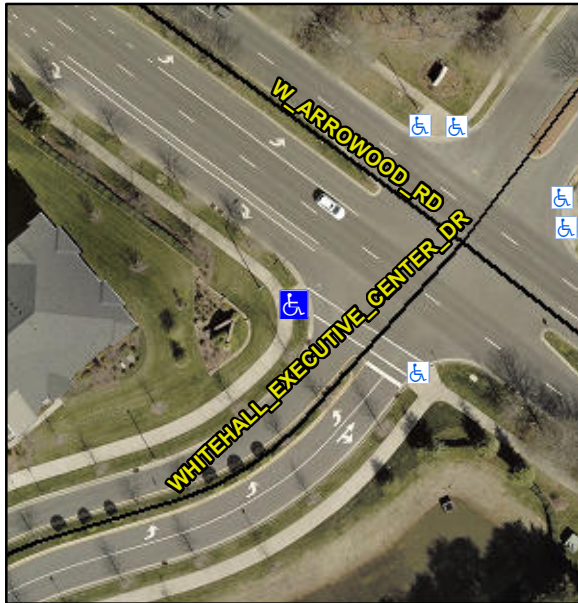

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.3.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	44.0	N/A	Ramp Length RT (in)	48.0
Yes	Ramp Width LT (in)	96.0	Yes	Ramp Width RT (in)	92.0
No	Ramp Slope LT (%)	8.5	Yes	Ramp Slope RT (%)	6.4
Yes	Ramp XSlope LT (%)	1.6	Yes	Ramp XSlope RT (%)	0.2
N/A	Ramp Length (in)	98.5	Yes	Ramp Slope (%)	6.3
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.7
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	112.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.4		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	1.6
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.2		Clear Space?	N/A
	Road X Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	9.8

Total Cost: \$ 3200.00

